



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

Case Vehicle (A): 1999 GMC
 Type: Suburban SLT 4 x 4, 4-door SUV
 Driver: 36-year-old female
 CDC: 03-RFEW-4

SITUATION

(Slide 1) It was daytime and snowing, and (slide 2) the 2-lane asphalt road surface was slush covered and slippery, but free of defects. Case vehicle (A) was traveling south at a driver-estimated speed of 72 kph (45 mph) in the southbound lane. (Slide 3) The driver of case vehicle (A) lost control of the vehicle, which veered to the left, went into a counterclockwise yaw, (slide 4) exited the east edge of the road surface, entered into a front yard, and (slide 5) struck a tree with its right side at the right-front fender. The driver of case vehicle (A) was taken to a regional level-1 trauma facility by ambulance and was hospitalized for one day. The right-front and right-rear passengers were taken to a regional level-1 trauma facility by ambulance and treated and released. The right-front passenger was later taken to his personal physician for a swollen ankle.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 6) The right-front fender of case vehicle (A) was severely crushed to the left, (slide 7) with the maximum crush of 73 cm at the center of the right fender. (Slide 8) Direct damage to case vehicle (A) began 50 cm to the rear of the right-front bumper corner and extended 56 cm further rearward.

Using the WinSMASH accident-reconstruction program and (slides 9, 10, 11 and 12) a crush profile measured for case vehicle (A), the following impact severity was calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	35 (22)	-6 (-4)	-34 (-21)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slide 13) On the right side, the upper and (slide 14) lower A- and B-pillars, roof siderail, and front door were damaged. (Slide 15) The right-front wheel was torn off. The front door was jammed closed but had been pried open by rescue personnel. (Slide 16) The rear door and quarter panel were slightly deformed and the right-side wheelbase was reduced 21 cm.

In the front, (slide 17) the hood, the right headlight assembly, the grille, and both hood hinges were damaged, and the right-front components were drawn rearward. The hood latch was damaged and jammed closed, but had been pried open by rescue or tow-yard personnel in order to disconnect the battery. (Slide 18) The rear edge of the hood was elevated, and it contacted, but did not penetrate, the damaged windshield. The bond was separated along the entire bottom edge of the windshield

On the left side, (slide 19) the fender was deformed, (slide 20) but there was no significant change in the wheelbase. (Slide 21) There was no damage to the rear of the vehicle.

Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, and (slides 22 and 23) both deployed during this right-side impact. (Slides 24, 25, 26 and 27) There was no damage to the module flaps/covers of either the steering-wheel or (slides 28, 29, 30 and 31) passenger airbag modules. (Slides 32 and 33) There was no damage to the steering-wheel rim or (slides 34 and 35) spokes. (Slide 36) The steering column was rotated to the left but there was no apparent vertical rotation of the steering column. The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
Driver (slides 37 & 38)	Transmission tunnel	20	to left
Right-front (slide 39) (slide 40) (slide 41)	Floor	15	up
	Instrument panel	11	to rear
	A-pillar	10	to left
	Door panel	10	to left
	A-pillar	9	to rear
	Door panel	9	to rear

In addition, (slide 42) the gas pedal was bent upward and the brake pedal was bowed. (Slide 43) The trim of the upper, mid, and lower instrument panels, the upper vent outlets, and the control knobs were knocked loose by impact forces. (Slide 44) The left sunvisor was broken off. (Slide 45) The rearview mirror was broken. The center console was deflected to the left. (Slides 46 and 47) The climate control ducts were crushed by the displacement of the heater and air-conditioning cores. In addition, the right-front door interior, right-front door armrest, right-front door hardware, right-front door window glass, (slide 48) right-roof siderail, and right B-pillar were damaged. (Slide 49) There was some dried blood on the lower right corner of the passenger-side frontal-impact airbag fabric. This blood was possibly from the right-rear passenger when he checked on the right-front passenger after the crash.

OCCUPANT KINEMATICS AND INJURIES

(Slide 50) The 5-ft, 6-in, 135-lb, 36-year-old female driver was not wearing the three-point belt, (slide 51) but the frontal-impact airbag deployed. (Slide 52) There were no witness marks on the plastic D-ring. On impact, the driver moved to the right and rearward relative to the vehicle interior, due to the rightward and counterclockwise rotational motion of the vehicle. (Slide 53) After the crash she was found on the floor of the vehicle behind the right-front seat. She sustained a right subdural hematoma with loss of consciousness, possibly from head contact with the center roof console (slides 54 and 55), as evidenced by a scuff mark. (Slide 56) She sustained bilateral pedicle fractures of C2, with a 2-mm anterior displacement of C2 over C3, due to flexion and compression of the neck, possibly from head contact with the floor and/or the right-side rear door. She sustained minor compression fractures of T5, T6, and T11 due to compressive loading of the spine, probably from the same head contact that resulted in the neck fractures.

She also sustained a contusion to the posterior region of her right shoulder, possibly from contact with the right-front seatback or from contact with the floor. She sustained contusions to her right and left buttocks, possibly from contact with the center console, (slides 57 and 58) as evidenced by a scuff mark, or possibly due to contact with the floor. She sustained contusions to her right and left knees, from unknown contacts. (Slide 59) She sustained an open fracture to the distal shaft of the right fibula, probably from contact with the transmission tunnel.

(Slide 60) The 4-ft, 0-in, 55-lb, 10-year-old male, right-front passenger has multiple birth defects including cerebral palsy. (Slide 61) He was restrained by a five-point harness in a “Tumble Form” positioning seat that was secured by the lap portion of the vehicle’s three-point belt, and the passenger-side airbag deployed. (Slide 62) There were no witness marks on the plastic D-ring, (slide 63) but the lap portion of the three-point belt was well worn. The top tether of the “Tumble Form” seat was not fastened. The right-front passenger sustained a hairline fracture to his left distal fibula, probably from leg contact with the glove box area, (slide 64) as evidenced by a scuff mark on the plastic cover.

(Slide 65) The 5-ft, 8-in, 130-lb, 15-year-old male, right-rear passenger was restrained by the three-point belt. (Slide 66) There were wear marks on the plastic D-ring, indicating general belt use, but there were no clear witness marks from occupant loading. He sustained multiple small lacerations to his face, neck, and both hands, due to flying broken glass. He sustained a small puncture wound to the left occipital region, probably due to flying broken glass.

The following tables and attached drawings (slides 67, 68 and 69) summarize the injuries sustained by the three occupants of case vehicle (A).

Occupant: Driver
 Restraints: 3-point belt not worn; airbag deployed

Age: 36 years
 Stature: 168 cm (5 ft, 6 in)

Gender: Female
 Mass: 61 kg (135 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Right subdural hematoma, with loss of consciousness	4			Center roof console
Fractures, bilateral pedicles of C2 with 2-mm anterior displacement of C2 over C3	3			Head contact with right-rear door/floor
Contusion, posterior aspect of right shoulder	1			Right-front seatback/floor
Minor compression fractures, T5, T6 and T11	2			Head contact with right-rear door/floor
Contusion, right buttock	1			Center console/floor
Contusion, left buttock	1			Center console/floor
Open fracture, distal-shaft right fibula	2			Transmission tunnel
Contusion, right knee	1			Unknown
Contusion, left knee	1			Unknown
<u>Maximum A.I.S. Level</u>	<u>4</u>			
<u>Injury Severity Score</u>	<u>24</u>			

Occupant: Right front*

Restraints: In "Tumble Form" positioning seat with five-point harness; Positioning seat secured by the vehicle lap belt only; top tether not fastened; frontal-impact airbag deployed

Age: 10 years

Stature: 122 cm (4 ft, 0 in)

Gender: Male

Mass: 25 kg (55 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Hairline fracture, distal left fibula	2		Glove box	
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>4</u>			

*This occupant has severe birth defects including cerebral palsy

Occupant: Right rear

Restraints: 3-point belt worn

Age: 15 years

Stature: 180 cm (5 ft, 8 in)

Gender: Male

Mass: 59 kg (130 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Small puncture wound, left occipital region	1		Broken glass	
Small lacerations, face and neck	1		Broken glass	
Small lacerations, both hands	1		Broken glass	
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>1</u>			

TIME

DATE OF COLLISION

 / /

HOUR OF COLLISION
(24 HOUR CLOCK)

LOCATION

STATE:

STATE FIPS CODE

AREA

- (1) URBAN
(2) RURAL
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
(1) YES
(9) UNKNOWN

ROAD, TOTAL TRAFFIC LANES
(FOR CASE VEHICLE)

- (1) 1-LANE
(2) 2-LANES
(3) 3-LANES
(4) 4 OR MORE LANES
(5) DIVIDED, 4 OR MORE LANES
(6) PARKING LOT/DRIVEWAY
(7) OTHER:
(9) UNKNOWN

INTERSECTING RD, TOTAL LANES

CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

TYPE OF ROAD SURFACE

- (1) ASPHALT
(2) CONCRETE
(3) GRAVEL
(4) MORE THAN ONE (CIRCLE EACH)
(7) OTHER:
(9) UNKNOWN

ROAD DEFECTS

- (0) NO
(1) YES
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
(1) YES
(9) UNKNOWN

ROAD ALIGNMENT
VERTICAL PLANE

- (1) LEVEL
(2) CREST OF HILL
(3) SLOPE (2%)
(4) BOTTOM OF HILL
(9) UNKNOWN

ROAD ALIGNMENT
HORIZONTAL PLANE

- (1) STRAIGHT
(2) CURVE
(3) T - SHAPED
(4) Y - SHAPED
(7) OTHER:
(9) UNKNOWN

SURFACE COVERING

- (10) DRY

(21) WATER - DAMP
(22) WATER - WET
(23) WATER - PUDDLED
(29) WATER - AMOUNT UNKNOWN

(31) SNOW - LOOSE
(32) SNOW - PACKED
(39) SNOW - CONDITION UNKNOWN

(41) ICE
(51) SLUSH
(61) SPILLED GRAVEL
(71) OTHER:
(99) UNKNOWN

VISIBILITY LIMITATION
(FOR CASE VEHICLE)

- (0) NONE
(1) CLOUDY/DARK
(2) FOG
(3) SMOKE
(4) WINDSHIELD CONDITION
(5) GLARE
(6) RAIN
(7) OTHER:
(8) ICE/SNOW
(9) UNKNOWN

VISIBILITY OBSTRUCTION
(FOR CASE VEHICLE)

- (0) NONE
(1) BUILDING
(2) SIGN
(3) VEGETATION (E.G. BUSHES, SHRUBS)
(4) TREE
(5) HILL OR CURVE IN ROAD
(6) VEHICLE IN TRANSPORT
(7) OTHER:
(8) PARKED VEHICLE
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

SPEED LIMIT

- | | | |
|-----|-----------------|----------|
| (0) | 5-45 km/h | 5-25 mph |
| (1) | 46-55 | 30 |
| (2) | 56-60 | 35 |
| (3) | 61-70 | 40 |
| (4) | 71-79 | 45 |
| (5) | 80-85 | 50 |
| (6) | 86-90 | 55 |
| (7) | 91-105 | 60 |
| (8) | OVER 105 | 65 |
| (9) | UNKNOWN | |

PRECIPITATION

- (0) NONE
(1) RAIN
(2) SNOW
(3) HAIL
(4) FREEZING RAIN/SLEET
(7) OTHER: _____
(9) UNKNOWN

RATE OF PRECIPITATION

- (1) LIGHT/MIST
(2) MODERATE
(3) HEAVY
(8) NOT APPLICABLE
(9) UNKNOWN

TEMPERATURE

- (0) BELOW -15° C BELOW 5° F
(1) -15 TO -6 5 TO 22
(2) -5 TO -1 23 TO 31
(3) 0 TO 2 32 TO 36
(4) 3 TO 5 37 TO 41
(5) 6 TO 15 42 TO 59
(6) 16 TO 25 60 TO 77
(7) 26 TO 35 78 TO 95
(8) OVER 35 OVER 96
(9) UNKNOWN

CROSSWIND

- (0) NONE
(1) LIGHT
(2) STRONG
(3) GUSTY & STRONG
(9) UNKNOWN

LIGHT CONDITIONS

- (1) DAYLIGHT
- (2) DAWN
- (3) DUSK
- (4) DARK, LIGHTED
- (5) DARK, UNLIGHTED
- (6) DARK, UNKNOWN IF LIGHTED
- (9) UNKNOWN

MECHANICAL MALFUNCTION

WAS THERE MENTION
OF A MECHANICAL MALFUNCTION
IN CASE VEHICLE

- (0) NO
(1) YES
(2) YES, DID NOT CONTRIBUTE
TO ACCIDENT
(9) UNKNOWN

**THE FOLLOWING SECTION SHOULD BE FILLED
OUT IF A MECHANICAL MALFUNCTION IS
RECOGNIZED OR SUSPECTED.**

**CIRCLE ITEMS INVOLVED. SUPPORT ANY
ITEMS CIRCLED WITH COMMENTS.**

BRAKE SYSTEM

DRIVER CONTROLS

EXHAUST SYSTEM

POWER TRAIN

STEERING SYSTEM

FUEL SYSTEM

SUSPENSION SYSTEM

VISIBILITY ITEMS

ELECTRICAL SYSTEM

TIRES

THROTTLE CONTROLS

UNKNOWN

OTHER:

COMMENTS:

GENERAL INFORMATION GI-3

CRASH DETAILS

CASE VEHICLE AND OBJECT

- (0) NO
- (1) YES
- (9) UNKNOWN

1
47

CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER
- (1) YES, FIRST EVENT
- (2) YES, SUBSEQUENT EVENT
- (3) YES, SEQUENCE UNKNOWN
- (9) UNKNOWN

0
48

CASE VEHICLE RAN OFF ROADWAY (BEFORE FIRST IMPACT)

- (0) NO
- (1) YES
- (9) UNKNOWN

1
49

MOVING CASE VEHICLE AND CONTACTED MOVING VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
50

CASE VEHICLE AND CONTACTED STOPPED VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
51

STOPPED CASE VEHICLE AND CONTACTED VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
52

TOTAL NUMBER OF VEHICLES CONTACTED BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE
- (9) UNKNOWN

0
53

ANY FIRE IN THIS CRASH (NOT JUST CASE VEHICLE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
54

HIGHEST POLICE INJURY SEVERITY CODE IN CRASH (NOT JUST CASE VEHICLE)

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING INJURY
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO ACCIDENT
- (7) NON-FATAL INJURY
SEVERITY UNKNOWN
- (9) UNKNOWN

3
55

DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT (CASE VEHICLE)

- (0) NONE
- (1) YES
- (9) UNKNOWN/NOT REPORTED/
NO DRIVER

0
56

DRIVER ALCOHOL BAC (CASE VEHICLE)

- (80) NO TEST
- (90) CHEMICAL TESTS, NO RESULTS
- (95) AUTOPSY, NO RESULTS
- (99) UNKNOWN

80
57 58

WAS THERE MENTION OF DRIVER IMPAIRMENT FOR CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

0
59

LIST IMPAIRMENTS MENTIONED:

Post - CRASH DETAIL

MANNER CASE VEHICLE LEFT SCENE

- (1) DRIVEN
- (2) TOWED DUE TO DAMAGE
- (3) TOWED, NOT DUE TO DAMAGE
- (4) TOWED, REASON UNKNOWN
- (9) UNKNOWN

2
60

ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: Case vehicle (A) was traveling south
at a driver-estimated speed of 45 mph when the driver
lost control of the vehicle. Case vehicle exited the
east side of the road and struck a tree with its right-front fender.

CASE VEHICLE (A): 1999 GMC Suburban


OTHER VEHICLE (B): _____

THIRD VEHICLE (C): _____

G14



NORTH

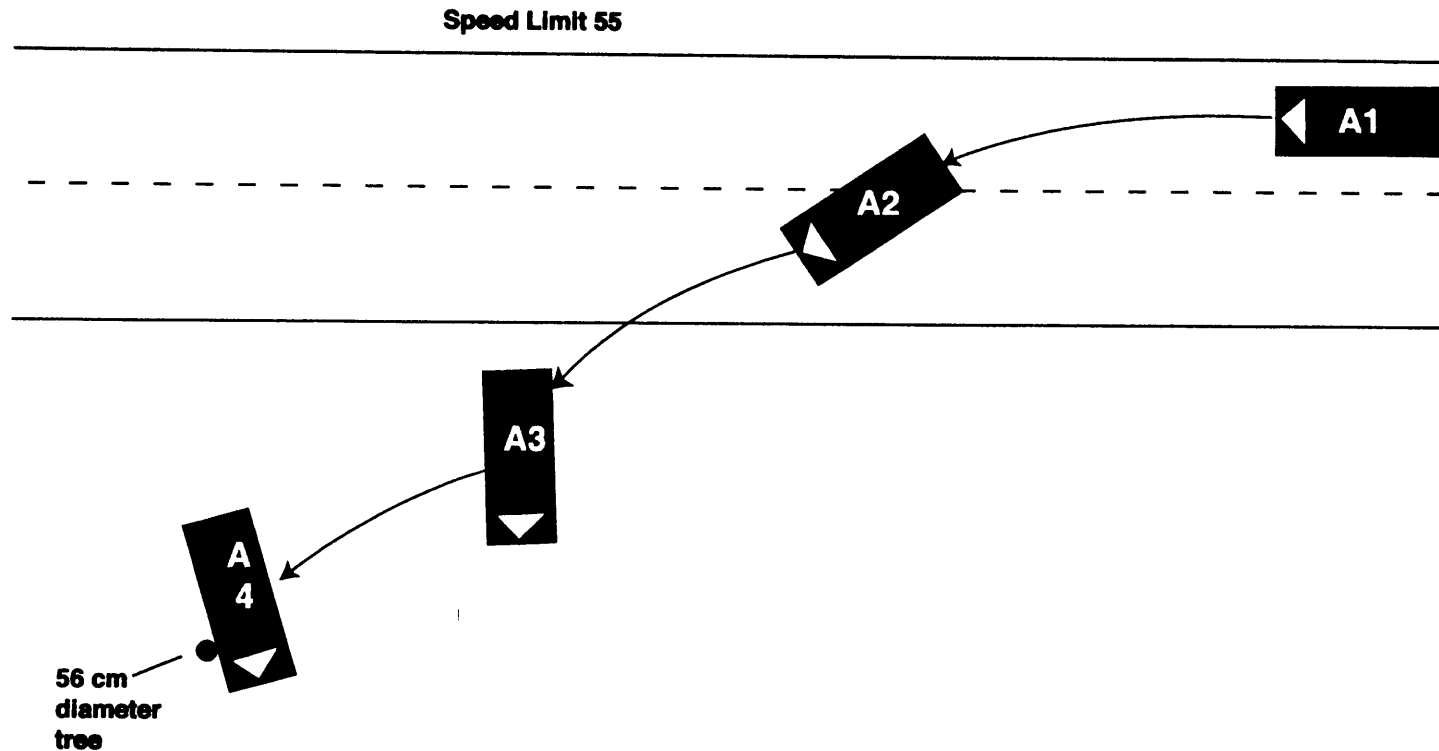

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 4
9 10 11 12

OTHER VEHICLE OV-1

MAKE: _____
MODEL: NOT APPLICABLE

CARGO: _____

VIN

13

29

MANUFAC/BODY CODE

30

34

MAKE/MODEL CODE

38

MODEL YEAR

39

42

VEHICLE MASS (kg)

43

48

IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER

NUMBER OF OCCUPANTS
(ENTER 9'S IF UNKNOWN)

51

TRAVELING SPEED (km/h)

54

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(8) UNOCCUPIED VEHICLE
(NOT APPLICABLE)
(9) UNKNOWN

55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
(03) LIMOUSINE
(17) PICKUP CAR
(20) UNKNOWN PASSENGER VEHICLE BODY
(24) SUB-MINI
(25) MINI
(26) SUB-COMPACT
(27) COMPACT
(28) INTERMEDIATE
(29) FULL

56

57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(17) PICKUP CAR WITH CANOPY/SHELL COVER
(21) MOTOR HOME
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(23) PICKUP CAR WITH SLIDE-IN CAMPER
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
(12) PICKUP TRUCK
(13) UNKNOWN LIGHT TRUCK
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(30) UNKNOWN TRUCK TYPE
(31) CHASSIS-MOUNTED CAMPER
(33) DELIVERY VAN (WALK-IN)
(34) STRAIGHT TRUCK
(35) TRUCK-TRACTOR (BOBTAIL)
(36) CHASSIS-CAB
(37) UNKNOWN HEAVY TRUCK
(38) TRACTOR & SEMI-TRAILER (SEMI)
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
(41) SCHOOL BUS
(42) INTERCITY BUS (BETWEEN CITIES)
(43) TRANSIT BUS (INTRACITY)
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
(69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)

(999) UNKNOWN

58 59 60

Duplicate columns 1-8
from the previous card.

Module Q V Format 0 2
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase	_____ cm	Front Overhang	_____ cm
			22 _____ 24
Curb Weight	_____ kg	Rear Overhang	_____ cm
			25 _____ 27
Average Track Width	_____ cm	Undeformed End Width (UEW)	_____ cm
	13 _____ 15		28 _____ 30
Overall Length	_____ cm	Engine Displacement	_____ L
	16 _____ 18		31 _____ 32
Overall Width (OAW)	_____ cm	Engine: # of Cylinders	_____
	19 _____ 21		33 _____ 34

VEHICLE DAMAGE

NOT APPLICABLE

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) _____ cm
35 _____ 37

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ _____ %
38 39

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ _____ %
40 41

Duplicate columns 1-8
from the previous card.

Module V D Format 0 4
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: GMC

MODEL: SUBURBAN SLT 4x4, 4-door

CARGO: _____

VIN 3 G M F K 1 6 R 7 X G

13

29

MANUFAC/BODY CODE 9 4 1 1 5

30

34

MAKE/MODEL CODE 3 0 0 3

38

MODEL YEAR 1 9 9 9

39

42

VEHICLE MASS (kg) 0 0 2 3 9 8

43

48

ODOMETER (km) 0 6 1 9 8 2

(ENTER 9'S IF UNKNOWN)

(ENTER 8'S IF ELECTRONIC)

49

54

NUMBER OF OCCUPANTS 0 3

(ENTER 9'S IF UNKNOWN)

(454)

56

TRAVELING SPEED (km/h) 0 7 2

59

(000) PARKED OR STOPPED

(995) JUST STARTING UP

(996) BACKING UP

(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)

(998) SPEED EXCESSIVE (BUT UNKNOWN)

(999) UNKNOWN

STOLEN VEHICLE

- (0) NO
(1) YES
(8) NOT COLLECTED
(9) UNKNOWN

8
62

BODY STRUCTURE

- (1) BODY & FRAME
(2) UNITIZED
(3) INTEGRAL-STUB FRAME
(4) BODY & PLATFORM FRAME
(E.G. VW BUG)
(5) PARTIALLY UNITIZED
(7) OTHER: _____
(9) UNKNOWN

1
63

TRANSMISSION

- (0) NONE
(1) AUTOMATIC
(2) MANUAL
(9) UNKNOWN

1
64

LOCATION OF TRANSMISSION SELECTOR LEVER

- (1) FLOOR
(2) CONSOLE
(3) COLUMN
(7) OTHER: _____
(9) UNKNOWN

3
65

STEERING

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
66

BRAKES

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
67

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)
(12) 2-DOOR SEDAN OR COUPE
(ANY UPPER B-PILLAR)
(13) 4-DOOR HARDTOP
(14) 4-DOOR SEDAN
(15) STATION WAGON
(16) CONVERTIBLE
(18) OTHER PASS. VEH.: _____
(19) PASSENGER VEHICLE, TYPE UNKNOWN

2 2
60 61

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(23) VAN, SIZE UNKNOWN
(24) VAN, SMALL (MINI)
(25) VAN, LARGE
(29) MPV, TYPE UNKNOWN
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN
(32) PICKUP TRUCK, SMALL (DOWNSIZED)
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

TYPE OF BRAKES

- (1) DRUM, ALL WHEELS
- (2) DISC, FRONT WHEELS
- (3) DISC, ALL WHEELS
- (9) UNKNOWN

2
68

WHEELBASE (cm)
(999) Unknown

334
76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
- (1) TWO-WHEEL
- (2) FOUR-WHEEL
- (7) EQUIPPED, UNKNOWN WHEELS
- (9) UNKNOWN

2
69

PLASTIC ANTI-LACERATIVE
INNER LAYER GLASS EQUIPPED

- (0) NONE
- (1) WINDSHIELD
- (2) WINDSHIELD AND SIDE
- (7) OTHER
- (9) UNKNOWN

0
79

AIR CONDITIONING IN VEHICLE

- (0) NO
- (1) YES
- (8) NOT COLLECTED
- (9) UNKNOWN

8
70

TYPE OF DRIVE

- (1) REAR WHEEL
- (2) FRONT WHEEL
- (3) FOUR WHEEL
- (4) ALL WHEEL DRIVE
- (9) UNKNOWN

3
71

DUAL REAR WHEELS

- (0) NO
- (1) YES
- (9) UNKNOWN

0
72

ORIGINAL TYPE
OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
- (2) PASSIVE BELT
- (3) AIRBAG
- (4) KNEE BOLSTERS
- (7) OTHER: _____
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

3
73

EQUIPPED WITH ROLL BAR

- (0) NO
- (1) YES
- (9) UNKNOWN

0
74

TYPE OF ROOF


- (0) NONE
- (1) SOLID
- (2) T-TOP CLOSED
- (3) T-TOP OPEN
- (4) SUN ROOF CLOSED
- (5) SUN ROOF OPEN
- (6) CONVERTIBLE CLOSED
- (7) CONVERTIBLE OPEN
- (8) OTHER: _____
- (9) UNKNOWN

1
75

FIELD INVESTIGATOR INSTRUCTIONS:

1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

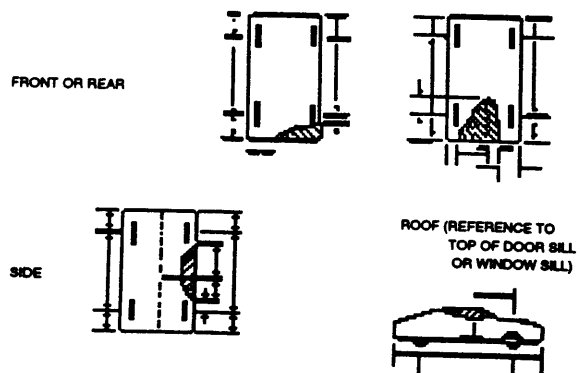

Duplicate columns 1-8
from the previous card.


Module V D Format 0 2
9 10 11 12

VEHICLE DESCRIPTION VD-3

ORIGINAL SPECIFICATIONS

Wheelbase	<u>334</u> cm	Front Overhang	<u>092</u> cm
Curb Weight	<u>2489</u> kg	Rear Overhang	<u>134</u> cm
Average Track Width	<u>168</u> cm	Undeformed End Width (UEW)	<u>180</u> cm
Overall Length	<u>558</u> cm	Engine Displacement	<u>5.7</u> L
Overall Width (OAW)	<u>195</u> cm	Engine: # of Cylinders	<u>08</u>

VEHICLE DAMAGE

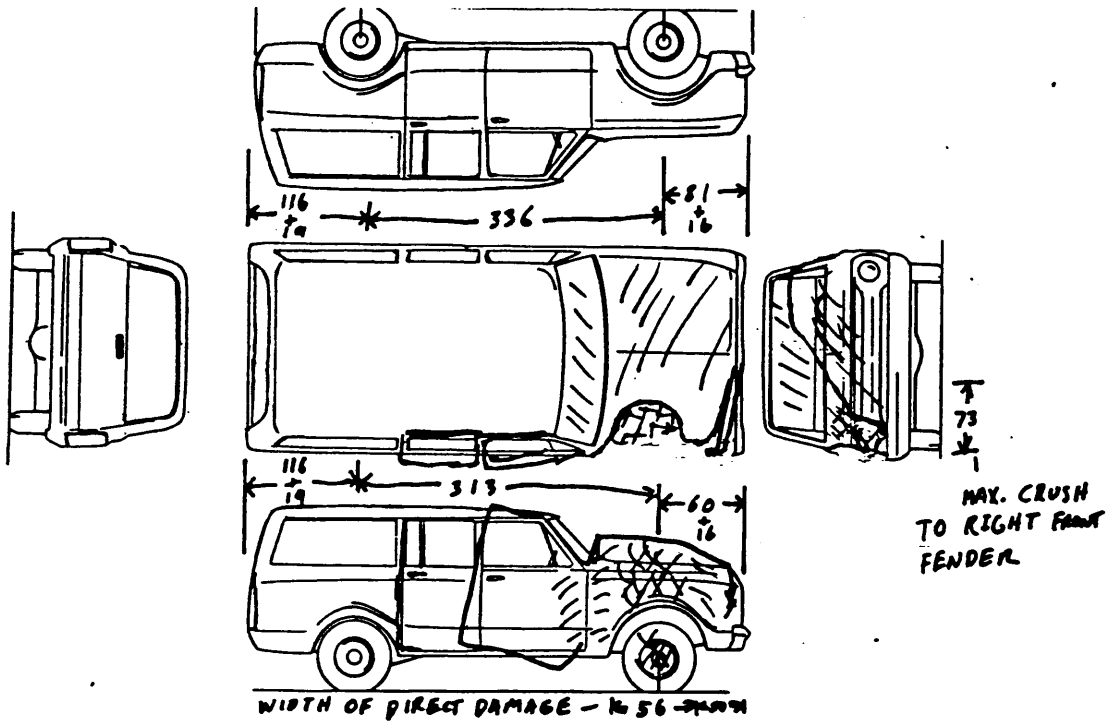

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 999 cm

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ 99 %

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ 99 %

Duplicate columns 1-8
from the previous card.

Module D A Format 0 2
9 10 11 12

DAMAGE DA-1

PRIMARY	CASE VEHICLE PRIMARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>998</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>8</u> 38
CRUSH (cm)	<u>073</u> 18 19 20	<u>998</u> 39 40 41
CDC #1	<u>03 R FEW 4</u> 21 27	<u>98.0000.0</u> 42 48
CDC #2	<u>98.0000.0</u> 28 34	<u>98.0000.0</u> 49 55

Duplicate columns 1-8
from the previous card.

Module D A Format 0 3
9 10 11 12

SECONDARY	CASE VEHICLE SECONDARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>8</u> 13	
IMPACT SPEED (km/h)	<u> </u> 14 15 16	<u> </u> 35 36 37
ESTIMATED BY	<u> </u> 17	<u> </u> 38
CRUSH (cm)	<u> </u> 18 19 20	<u> </u> 39 40 41
CDC #1	<u> </u> <u> </u> <u> </u> <u> </u> <u> </u> <u> </u> 21 27	<u> </u> <u> </u> <u> </u> <u> </u> <u> </u> <u> </u> 42 48
CDC #2	<u> </u> <u> </u> <u> </u> <u> </u> <u> </u> <u> </u> 28 34	<u> </u> <u> </u> <u> </u> <u> </u> <u> </u> <u> </u> 49 55

CODES

EVENT NUMBER

(8) NOT APPLICABLE
(9) UNKNOWN

IMPACT SPEED

(998) NOT APPLICABLE
(999) UNKNOWN

IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR
(2) DRIVER
(3) POLICE
(4) "CRASH" PROGRAM
(5) OTHER COMPUTER PROGRAM
SPECIFY: _____
(7) OTHER: _____
(8) NOT APPLICABLE
(NO VEHICLE/NO IMPACT)

CRUSH

(998) NOT APPLICABLE
(NO VEHICLE/DAMAGE)
(999) UNKNOWN

CDC

(9800000) NOT APPLICABLE
(9900000) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module D A Format 0 1
9 10 11 12

DAMAGE DA-2

MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 0 0 0
13 15

RIGHT SIDE 0 7 3
16 18

REAR 0 0 0
19 21

LEFT SIDE 0 0 0
22 24

ROOF 0 0 0
25 27

OTHER 0 0 0
28 30

CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

NOTE: IF CHRONOLOGICAL ORDER
IS UNKNOWN, EVENT
ORDER IS OPTIONAL.

DO YOU KNOW THIS TABLE
TO BE IN CHRONOLOGICAL ORDER? 1
31

(0) NO
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>4</u> 32	<u>47</u> 34	<u>77</u> Tree 36
#2	<u> </u> 37	<u> </u> 39	<u> </u> 41
#3	<u> </u> 42	<u> </u> 44	<u> </u> 46
#4	<u> </u> 47	<u> </u> 49	<u> </u> 51
#5	<u> </u> 52	<u> </u> 54	<u> </u> 56
#6	<u> </u> 57	<u> </u> 59	<u> </u> 61
#7	<u> </u> 62	<u> </u> 64	<u> </u> 66

CODES FOR
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

- (99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT
- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE

WHEELBASE

SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107", E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107", E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Duplicate columns 1-8
from the previous card.

Module C R Format 0 1
9 10 11 12

CRASH RECONSTRUCTION CR-1

for ΔV

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13			<u> </u> 47		
ΔV (km/h) TOTAL	<u>035</u> 14 15 16	<u>8 —</u> 32 33 34		<u> </u> 48 49 50	<u> </u> 66 67 68	
LONGITUDINAL*	<u>- 006</u> 17 20	<u>8 —</u> 35 38		<u> </u> 51 54	<u> </u> 69 72	
LATERAL*	<u>- 034</u> 21 24	<u>8 —</u> 39 42		<u> </u> 55 58	<u> </u> 73 76	
* NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = ± 010 -7 km/h = -007						
ENERGY DISSIPATED BY CRUSH (kJ)	<u>0190</u> 25 28	<u>8 —</u> 43 46		<u> </u> 59 62	<u> </u> 77 80	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u> </u> 63 64		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/ OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY	<u>2</u> 31			<u> </u> 65		
(2) CDC & DETAILED DAMAGE						
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: _____						

Duplicate columns 1-8
from the previous card.

Module C R Format 0 2
9 10 11 12

CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13			<u>47</u>		
EBS (km/h) TOTAL	<u>035</u> 14 15 16	<u>8</u> — 32 33 34		<u> </u> 48 49 50	<u> </u> 66 67 68	
LONGITUDINAL*	<u>-006</u> 17 20	<u>8</u> — 35 38		<u> </u> 51 54	<u> </u> 69 72	
LATERAL*	<u>-034</u> 21 24	<u>8</u> — 39 42		<u> </u> 55 58	<u> </u> 73 76	
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = ± 0 1 0 -7 km/h = - 0 0 7						
ENERGY DISSIPATED BY CRUSH (kj)	<u>0190</u> 25 28	<u>8</u> — 43 46		<u> </u> 59 62	<u> </u> 77 80	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u> </u> 63 64		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/ OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY						
(2) CDC & DETAILED DAMAGE	<u>2</u> 31			<u> </u> 65		
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: _____						

Duplicate columns 1-8
from the previous card.

Module C R Format 0 3
9 10 11 12

CRASH RECONSTRUCTION CR-3

NOTES:

1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS. REAR TO FRONT IN SIDE IMPACTS.
3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE

LOCATOR


Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	begin 50 cm rear of Rt. H. BL	223 cm rear of Rt. H. BL
		Begin Rt. H. BL

stands @
120 cm from
center

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

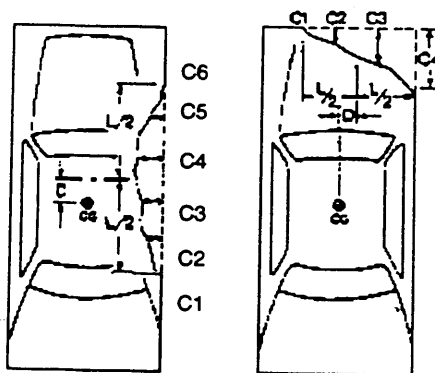

DL _____

UDL _____

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C_1	C_2	C_3	C_4	C_5	C_6	$\pm D$
		Length (DDL)	Max Crush								
1	4	56	95	223	0	8	31	95	68	31	+135
	Free space				-1	-1	-1	0	0	6	
	stand adjustment		-22		-22	-22	-22	-22	-22	-22	
1	4	056	073	223	000	000	008	073	046	003	+135
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

NOTES:


1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
4. USE THE CENTER OF THE WHEELBASE AS THE CG.

OTHER VEHICLE

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

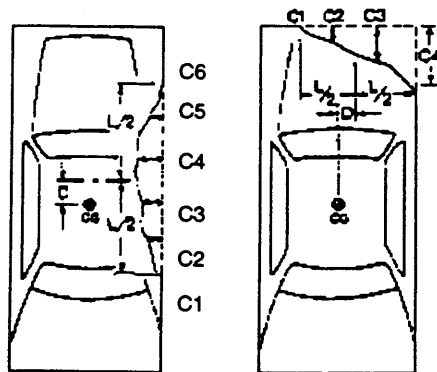

PLANE:

- (1) Bumper
(2) Above Bumper
(3) Sill
(4) Above Sill
(5) Other _____
(9) Unknown

DL _____

UDL _____

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

[illegible]

Duplicate columns 1-8
from the previous card.

Module W T Format 0 1
9 10 11 12

WHEELS AND TIRES

WT-1

WHEELS--DAMAGED

- (0) NO
(1) YES
(9) UNKNOWN

LF 0
13

RF 1

RR 0

LR 0
16

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P 24 57 5R 16
25

RF ↓
30

RR ↓
40

LR ↓
55

TIRE TREAD TYPE

- (1) REGULAR
(2) SNOW
(3) SLICKS
(4) ALL WEATHER (MS)
(7) OTHER: _____
(9) UNKNOWN

LF 4
17

RF 4

RR 4

LR 4
20

CARCASS CONSTRUCTION

- (1) BIAS
(2) BELTED BIAS
(3) RADIAL
(4) ELLIPTICAL
(5) HI PRESSURE SPARE
(6) SPACE SAVER SPARE
(7) OTHER: _____
(9) UNKNOWN

LF 3
21

RF 3

RR 3

LR 3
24

IF VEHICLE IS EQUIPPED WITH DUAL
WHEELS, COMPLETE FOR OUTER WHEELS
AND MAKE NOTES ON INNER WHEELS.

NOTES: _____

Duplicate columns 1-8
from the previous card.

Module F T Format 0 1
9 10 11 12

FUEL AND FUEL TANKS FT-1

TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: _____ (9) UNKNOWN	<u>1</u> 13	AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN	<u>8</u> 21
MAIN TANK LOCATION	<u>1 2 2</u> 14 16	AUXILIARY TANK LOCATION	<u>8 8 8</u> 22 24
MAIN FILLER CAP LOCATION	<u>1 1 2</u> 17 19	AUXILIARY FILLER CAP LOCATION	<u>8 8 8</u> 25 27
MAIN TANK MATERIAL	<u>3</u> 20	AUXILIARY TANK MATERIAL	<u>8</u> 28

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F L Format 0 1
9 10 11 12

FUEL LEAKAGE FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

0
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u> </u> <u> </u> 14 15	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 21
#2	<u> </u> <u> </u> 22 23	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 29
#3	<u> </u> <u> </u> 30 31	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 37
#4	<u> </u> <u> </u> 38 39	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 45
#5	<u> </u> <u> </u> 46 47	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 53

I LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN

- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT (LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT (LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F R Format 0 1
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

0
13

(1) YES COMPLETE PAGE.

DID FIRE START IN CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
(2) MODERATE
(3) SEVERE
(9) UNKNOWN

16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
(2) SLOW/MODERATE
(9) UNKNOWN

15

DID AN INJURY TO CASE
VEHICLE OCCUPANT RESULT FROM
FIRE IN OR ON CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8
from the previous card.

Module E D Format 0 1
9 10 11 12

EXTERIOR DAMAGE

ED-1

HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES) -RELEASED

0
13

-DAMAGED

1
14

-JAMMED

1
15

HOOD HINGES- -LEFT, DAMAGED

1
16

-LEFT, SEPARATED
(COMPLETE)

0
17

-RIGHT, DAMAGED

1
18

-RIGHT, SEPARATED
(COMPLETE)

0
19

HOOD REMAINED ON VEHICLE

1
20

REAR EDGE OF HOOD- -ELEVATED

1
21

-CONTACTED WINDSHIELD

1
22

-PENETRATED WINDSHIELD

0
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1
24

STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OTHER: _____
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9
26

COUPLING- -DAMAGED

9
27

(USE CODES
FROM HOOD
PERFORMANCE)

-SEPARATED
(COMPLETE)

9
28

ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: _____
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8
29 30

ORIGINAL LENGTH (mm)

F (OR H): _____

TELESCOPED LENGTH (mm)

G: _____

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO
COMPRESSION
- (992) COMPRESSED, AMOUNT
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT
EQUIPPED)
- (999) UNKNOWN

8 8 8
31 32 33

ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
25

LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 34

LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 35

LOWER

0
 36

-B-PILLAR, UPPER

0
 37

LOWER

0
 38

-C-PILLAR, UPPER

0
 39

LOWER

0
 40

-D-PILLAR, UPPER

0
 41

LOWER

0
 42

LEFT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 43

-REAR

0
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 45

-REAR

0
 46

REAR DOOR

REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door

HOW DID DOOR
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

6
47

OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

8
50

SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

8
51

TRAILER HITCH TYPE

- (0) NO HITCH

BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL. P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)

- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

2
52

TRAILER TYPE
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: _____
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

2
53

0
48

0
49

RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 54

RIGHT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION
 (02) DOOR-LATCH SEPARATION
 (03) LATCH-STRIKER SEPARATION
 (04) STRIKER-PILLAR SEPARATION
 (05) BODY DISTORTION
 (06) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (07) OPENED, REASON UNKNOWN
 (11) VAN RIGHT-REAR DOOR OPENED
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

4
 55

LOWER

4
 56

-B-PILLAR, UPPER

4
 57

LOWER

4
 58

-C-PILLAR, UPPER

0
 59

LOWER

0
 60

-D-PILLAR, UPPER

0
 61

LOWER

0
 62

-FRONT

0 0
 63 64

-REAR

0 0
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

1
 67

-REAR

0
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR
 (1) TRACK (SLIDING) - RIGHT SIDE
 (2) SINGLE-HINGED - RIGHT SIDE
 (3) DOUBLE-HINGED - RIGHT SIDE
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE
 (7) TRACK AND HINGED COMBINATION
 (8) NOT APPLICABLE (NOT A VAN)
 (9) UNKNOWN

8
 69

WINDSHIELD DAMAGE

WINDSHIELD CRACKED

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

WINDSHIELD BROKEN
(PLASTIC INTERLAYER TORN)

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

CRACKED OR BROKEN
BY OCCUPANT CONTACT

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

EXTENT OF BOND SEPARATION

- (0) NONE
(1) 1 - 20%
(2) 21 - 40%
(3) 41 - 60%
(4) 61 - 80%
(5) 81 - 99%
(6) TOTAL
(7) SEPARATED, AMOUNT
UNKNOWN
(8) NOT APPLICABLE
(9) UNKNOWN

40%

WINDSHIELD MARK ON CASE VEHICLE:



WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
(98) NOT APPLICABLE (NO WINDSHIELD)
(99) UNKNOWN

99
74 75


ROOF

DID T-ROOF/SUN ROOF OPEN
DURING COLLISION?

- (0) NO
(1) YES
(8) NOT APPLICABLE
(NOT A T-ROOF OR SUN ROOF)
(9) UNKNOWN

8
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

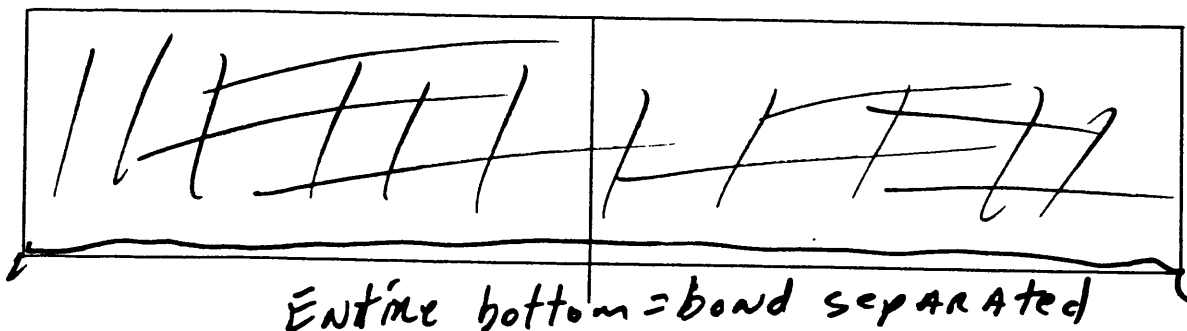

L

C

R

STEERING WHEEL

STEERING WHEEL RIM DAMAGE

- (0) NONE
(1) DEFORMED SLIGHTLY
(2) SEVERELY BENT
(3) BROKEN
(9) UNKNOWN

0
13

NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4
14

STEERING WHL SPOKE DAMAGE

- (0) NONE
(1) DEFORMED SLIGHTLY
(2) SEVERELY BENT
(3) BROKEN
(9) UNKNOWN


0
15

STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE
NORMAL TOP OF THE WHEEL POINTED
WHEN THE COLLISION OCCURRED?


EXAMPLES

O'CLOCK = 12

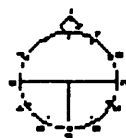

(NORMAL STRAIGHT
AHEAD)

O'CLOCK = 9.2

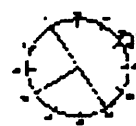

O'CLOCK = 9.9


(99) UNKNOWN

STEERING WHEEL ENERGY ABSORBING DEVICE



(1) EXAMPLES:

BARRACUDA, 70 - 74
CHALLENGER, 70 - 74
CAPRI, 71 - 77

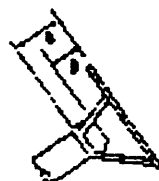

(2) EXAMPLES:

OMNI, 78 -
HORIZON, 78 -

STEERING COLUMN OPTIONS

TILT FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED, UNK POSITION
(2) UP
(3) MIDDLE
(4) LOWER
(9) UNKNOWN IF EQUIPPED

3
16

SWING-AWAY FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED
(9) UNKNOWN IF EQUIPPED

0
17

TELESCOPING FEATURE

- (0) NOT EQUIPPED
(1) YES, EQUIPPED
(9) UNKNOWN IF EQUIPPED

0
18

TYPE OF DEVICE

- (0) NONE
(1) CONVOLUTED OR MESH CYLINDER
(2) DEEP DISH STEERING WHEEL
(7) OTHER: _____
(8) NOT COLLECTED
(9) UNKNOWN IF EQUIPPED

ORIGINAL DIMENSION (mm)

A: _____

DAMAGE DIMENSION (mm)

B: _____

DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
COMPRESSION
(992) COMPRESSED, AMOUNT UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO MEASURE
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN

8
19

8 8 8
20 21 22

STEERING WHEEL AND COLUMN SC-2

STEERING COLUMN ENERGY ABSORBING DEVICE

TYPE OF DEVICE * (IF 27 OR 28)

- (00) NOT EQUIPPED
- (88) NOT COLLECTED
- (99) UNKNOWN

ORIGINAL LENGTH (mm)

C: _____

COMPRESSED LENGTH (mm)

D: _____

BRACKET DEFLECTION (IF CODE 36, 48,
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE: ± 10)


- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT
COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

* (ADD A & B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT & RIGHT CAPSULES.)

LT:

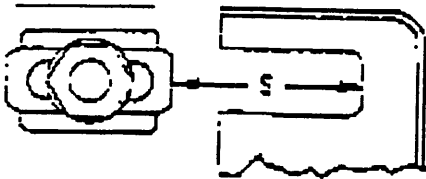

RT:

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT
SEPARATION
- (992) SEPARATED, AMOUNT UNKNOWN
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION
- (1) UPWARD APPARENT ROTATION
- (2) DOWNWARD APPARENT ROTATION
- (9) UNKNOWN

COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION
- (1) LEFT APPARENT ROTATION
- (2) RIGHT APPARENT ROTATION
- (9) UNKNOWN

STEERING WHEEL (CONTINUED)

STEERING WHEEL HUB DAMAGE

- (0) NONE
- (1) OCCUPANT CONTACT
- (2) AIRBAG
- (3) OTHER _____
- (9) UNKNOWN

0
33

8 8
23 24

8 8 8
25 27

8 8 8
28 30

0
31

1
32




INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	Intruded Value	Intrusion	
11	TRAM TUNNEL	62	42	= 20	Y
11	IP	126	—	= 0	X
11	IP	78	78	= 0	X
		—		=	
13	IP	78	67	= 11	X
13	A-pillar, door	62	52	= 10	AY
17	FLOOR	—		= (15)	Z
13	A-pillar	94	85	= 9	X
		—		=	
		—		=	
		—		=	
		—		=	
		—		=	
		—		=	
		—		=	
		—		=	
		—		=	

OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	KNEE BOLSTER	DA	Rt. Leg	Scuff	1
B	CENTER CONSOLE	DA	Legs OR Buttocks	Scuff	1
C	GLOVE BOX	RF	Legs	Scuff	2
D	Roof	DA	Head	Scuff	1
E					
F					
G					
H					
I					
J					

VEHICLE OCCUPANT CONTACT DIAGRAM

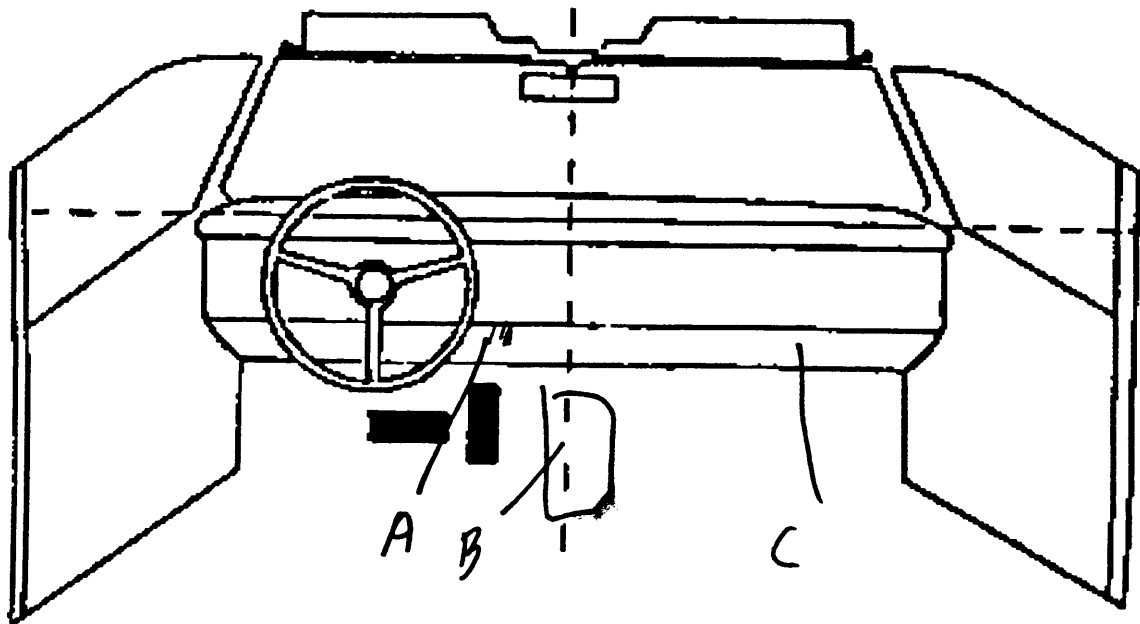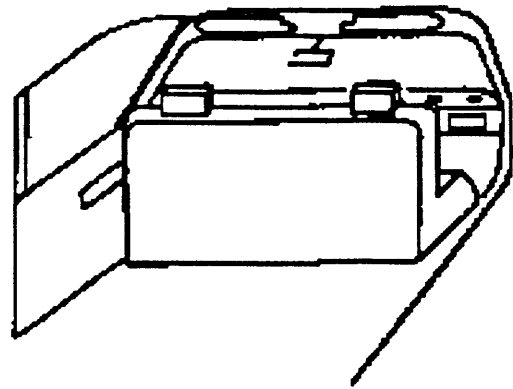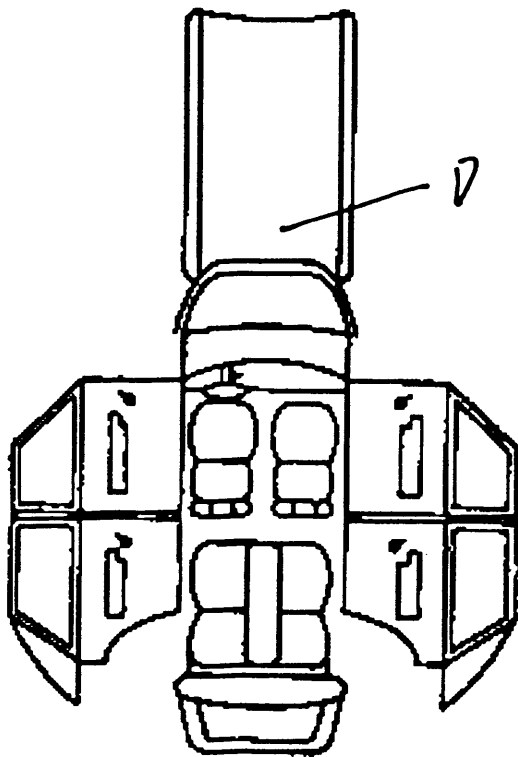

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- | | | | |
|--------------------------|-----------------|-------------------------|---|
| (1) LEFT | (3) RIGHT | | INDIVIDUAL SEAT |
| (1) LEFT | (2) CENTER | (3) RIGHT | BENCH: FULL WIDTH 3 PASSENGER |
| (1) LEFT | (2) LEFT CENTER | (6) RIGHT CENTER | (3) RIGHT BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT | (2) CENTER | (5) RIGHT & AISLE SPACE | BENCH: PARTIAL WIDTH, LEFT |
| (0) LEFT & SPACE | (2) CENTER | (5) RIGHT & SPACE | BENCH: PARTIAL WIDTH, CENTERED |
| (4) ENTIRE VEHICLE WIDTH | | CARGO AREA | |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X		

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
(Y) Y-AXIS (LATERAL)
(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	CONTACT
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (DESCRIBE)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER
COMPARTMENT BUT PART
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (E.G. SPARE TIRE,
JACK. DESCRIBE.)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS
INTRUDED INTO A SINGLE OCCUPANT SPACE.

- | | |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF SIDE RAIL | A-PILLAR |
| | B-PILLAR |
| (51) INSTRUMENT PANEL | C-PILLAR |
| A-PILLAR | WINDOW FRAME |
| DOOR PANEL | DOOR PANEL |
| | FLOOR PAN |
| (52) INSTRUMENT PANEL | (61) INSTRUMENT PANEL |
| A-PILLAR | TOE PAN |
| WINDSHIELD HEADER | WINDSHIELD HEADER |
| | A-PILLAR |
| (53) DOOR PANEL | ROOF RAIL |
| B-PILLAR | WINDOW FRAME |
| ROOF RAIL | DOOR PANEL |
| | ROOF |
| (54) DOOR PANEL | (62) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF RAIL | C-PILLAR |
| | WINDOW FRAME |
| (55) INSTRUMENT PANEL | FLOOR PAN |
| FLOOR PAN | SECOND SEAT |
| A-PILLAR | DOOR PANEL |
| DOOR FRAME | |
| (56) ROOF RAIL | (63) ROOF RAIL |
| A-PILLAR | ROOF |
| B-PILLAR | B-PILLAR |
| WINDOW FRAME | WINDOW FRAME |
| | FLOOR PAN |
| (57) ROOF RAIL | DOOR PANEL |
| A-PILLAR | SECOND SEAT |
| B-PILLAR | FRONT SEAT |
| C-PILLAR | |
| DOOR PANEL | (64) ROOF RAIL |
| | ROOF OR CONVERTIBLE TOP |
| (58) ROOF | A-PILLAR |
| ROOF RAIL | B-PILLAR |
| WINDOW FRAME | WINDOW FRAME |
| DOOR PANEL | WINDOW HEADER |
| (59) BACKLIGHT HEADER | (65) WINDSHIELD |
| ROOF | WINDSHIELD HEADER |
| C-PILLAR | ROOF SIDE RAIL |
| THIRD SEAT-BACK | |
| | (66) WINDSHIELD |
| | WINDSHIELD HEADER |
| | A-PILLAR |
| | (98) NOT APPLICABLE |
| | (99) UNKNOWN |

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 1
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 1
13

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE. -
(1) YES ANSWER NEXT QUESTION.
(9) UNKNOWN SKIP PAGE.

WAS INTRUSION CATASTROPHIC? 0
14

- (0) NO COMPLETE PAGE.
(1) YES SKIP PAGE.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 2
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	<u>11</u>	<u>28</u>	<u>1</u>	<u>00</u>	<u>20</u>	<u>00</u>	<u>01</u>	<u>09</u>	<u>00</u>	<u>00</u>
<u>0 2</u>	<u>13</u>	<u>04</u>	<u>1</u>	<u>00</u>	<u>00</u>	<u>15</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 3</u>	<u>13</u>	<u>01</u>	<u>1</u>	<u>11</u>	<u>00</u>	<u>00</u>	<u>02</u>	<u>01</u>	<u>00</u>	<u>06</u>
<u>0 4</u>	<u>13</u>	<u>08</u>	<u>1</u>	<u>09</u>	<u>10</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 5</u>	<u>13</u>	<u>09</u>	<u>1</u>	<u>09</u>	<u>10</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>	<u>00</u>
<u>0 6</u>	---	---	---	---	---	---	---	---	---	---
<u>0 7</u>	---	---	---	---	---	---	---	---	---	---

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 3
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,
SKIP REMAINDER OF PAGE.

SIDE DOOR INTRUSION
RESULTED FROM

INTRUSION
NUMBER CAUSE

CODES
FOR CAUSE:

0 5 2

- (1) DIRECT
IMPACT
(2) INDUCED
DAMAGE
(9) UNKNOWN

IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED
DOOR INTRUSION, CODE COMPONENT

INTRUSION
NUMBER

DAMAGED
COMPONENT 1

DAMAGED
COMPONENT 2

CODES
FOR COMPONENTS

A 05

0

0

- (0) NONE
(1) A-PILLAR
(2) B-PILLAR
(3) C-PILLAR
(4) LATCH/STRIKER
(5) HINGES
(7) OTHER: _____

B _____

C _____

D _____

- (8) NOT APPLICABLE
(9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 2
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

- ADDITIONAL PAGE -

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>0 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 6</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 7</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 8</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>1 9</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 0</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 1</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 2</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 3</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 4</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —
<u>2 5</u>	— —	— — —	—	— — —	— — —	— — —	— — —	— — —	— — —	— — —

Duplicate columns 1-8
from the previous card.

Module 1 D Format 0 1
9 10 11 12

INTERIOR DAMAGE

ID-1

CODES:

- (0) NO
(1) YES
(3) NO, and OCCUPANT CONTACT

- (4) YES, and OCCUPANT CONTACT
(8) NOT APPLICABLE
(9) UNKNOWN

	LEFT	RIGHT			
SIDES			FRONT		INSTRUMENT PANEL
FRONT DOOR	<u>0</u> 13	<u>4</u> 14	FOOT CONTROLS	<u>1</u> 45	UPPER PANEL
FRONT HARDWARE	<u>0</u> 15	<u>1</u> 16	IGNITION KEYS	<u>0</u> 46	MID PANEL
FRONT ARMREST	<u>0</u> 17	<u>1</u> 18	REAR VIEW MIRROR	<u>1</u> 47	LOWER PANEL
FRONT GLASS	<u>0</u> 19	<u>1</u> 20	SUNVISOR/FITTINGS	<u>5</u> 48	ASHTRAY
REAR DOOR AREA	<u>0</u> 21	<u>3</u> 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES		CONTROL KNOBS & LEVERS
REAR HARDWARE	<u>0</u> 23	<u>0</u> 24	WINDSHIELD TOP MOLDINGS	<u>0</u> 49	GLOVE COMPARTMENT AREA
REAR ARMREST	<u>0</u> 25	<u>0</u> 26	LEFT A-PILLAR (UPPER OR LOWER)	<u>0</u> 50	INSTRUMENTS
REAR GLASS	<u>0</u> 27	<u>0</u> 28	RIGHT A-PILLAR (UPPER OR LOWER)	<u>1</u> 51	PARKING BRAKE RELEASE
ROOF SIDE RAIL	<u>0</u> 29	<u>1</u> 30	CENTER CONSOLE	<u>4</u> 52	PARKING BRAKE PEDAL
B-PILLAR	<u>0</u> 31	<u>1</u> 32	TRANSMISSION SELECTOR LEVER	<u>0</u> 53	A/C OR UPPER VENT OUTLETS
C-PILLAR	<u>0</u> 33	<u>0</u> 34	RIM, HORN, SPOKE	<u>0</u> 54	HEATER OR A/C DUCTS
D-PILLAR	<u>0</u> 35	<u>0</u> 36			RADIO
HEADLINING	<u>0</u> 37	<u>0</u> 38			OTHER: * _____
ROOF STRUCTURE	<u>0</u> 39	<u>0</u> 40			_____
T-ROOF/SUN ROOF	<u>8</u> 41	<u>8</u> 42			
OTHER: * _____	<u>8</u> 43	<u>8</u> 44			
					REAR
					WINDOW
					WINDOW HEADER
					CONSOLES
					VERTICAL
					ROOF

* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8
from the previous card.

Module S T Format 0 2
9 10 11 12

SEATS

ST-1

FRONT SEAT

TYPE OF FRONT SEAT

- (00) NO SEAT
- (01) STANDARD BENCH
- (02) SPLIT BACK, 50-50
- (03) SPLIT BACK, DRIVER WIDE
- (04) SPLIT BACK, PASS. WIDE
- (05) BUCKET
- (06) CAPTAIN'S CHAIR
- (07) INDIV. BENCH, 50-50
- (08) INDIV. BENCH, DRIVER WIDE
- (09) INDIV. BENCH, PASS. WIDE
- (97) OTHER: _____
- (99) UNKNOWN

TYPE OF SEAT MOUNT

- (1) STANDARD
- (2) PEDESTAL
- (7) OTHER: _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

SWIVEL MECHANISM EQUIPPED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

ORIGINAL EQUIPMENT SEATS

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

CONTACT OF SEAT BY REAR OCCUPANT

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

FRONT SEAT DAMAGE

- (0) NONE
- (1) BACKREST ONLY DAMAGED
- (2) CUSHION ONLY DAMAGED
- (3) BACKREST &
CUSHION DAMAGED
- (8) NOT APPLICABLE
- (9) UNKNOWN

CENTER ARMREST DAMAGED

- (0) NO
- (1) YES
- (7) EQUIPPED, DAMAGE UNKNOWN
- (8) NOT APPLICABLE
- (NO CENTER ARMREST)
- (9) UNKNOWN IF EQUIPPED

FRONT SEAT ROTATION

- (0) NONE APPARENT
- (1) FORWARD APPARENT
- (2) REARWARD APPARENT
- (3) LEFT APPARENT
- (4) RIGHT APPARENT
- (5) MULTIPLE ROTATIONS
SPECIFY _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

DRIVER

PASSENGR

05
13 14

05
15 16

2
17

2
18

0
19

0
20

1
21

1
22

0
23

0
24

0
25

2
26

1
27

0
28

4
29

FRONT SEAT-BACK

SEAT-BACK TYPE

- (1) FORWARD FOLDING
- (2) RIGID
- (3) RECLINING
- (7) OTHER: _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

SEAT-BACK LOCK TYPE

- (0) NONE
- (1) MANUAL
- (2) INERTIA
- (3) POWER
- (7) OTHER: _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

LOCKS HELD

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

RECLINER MECHANISM HELD

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

DRIVER

PASSENGR

3
30

3
31

1
32

1
33

1
34

1
35

1
36

1
37

HEAD RESTRAINT

HEAD RESTRAINT TYPE

- (0) NONE
- (1) ADJUSTABLE
- (2) INTEGRAL
- (3) NOT INTEGRAL, BUT
CANNOT BE REMOVED
- (7) OTHER: _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

REMOVED PRE-CRASH

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

ADJUSTMENT AT CRASH

- (1) UP
- (2) DOWN
- (8) NOT APPLICABLE
- (9) UNKNOWN

HEAD RESTRAINT DAMAGE

- (0) NONE
- (1) DAMAGED BUT
NOT SEPARATED
- (2) SEPARATED
- (8) NOT APPLICABLE
- (9) UNKNOWN

1
38

1
39

0
40

0
41

2
42

2
43

0
44

0
45

Duplicate columns 1-8
from the previous card.

Module A B Format 0 1
9 10 11 12

AIRBAG AB-1

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>1</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>0</u> 21</p> <p><u>0</u> 22</p>


AIRBAG NUMBER ON DRIVER SIDE:

RF 11 T
7 W

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

2 JENTS @
11 + 1

LF 11 T
7 W

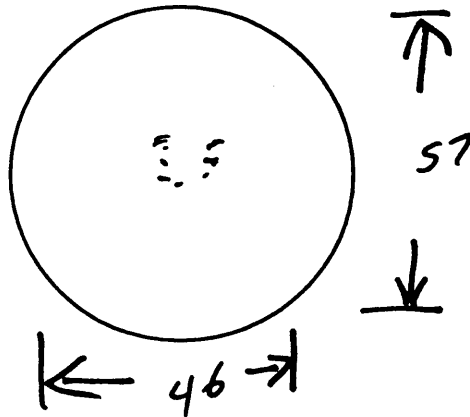


AIRBAG NUMBER ON PASSENGER SIDE:

UF 32 W
7 T

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

2 JENTS @
3 + 9 on
SIDE

LF 32 W
6 T

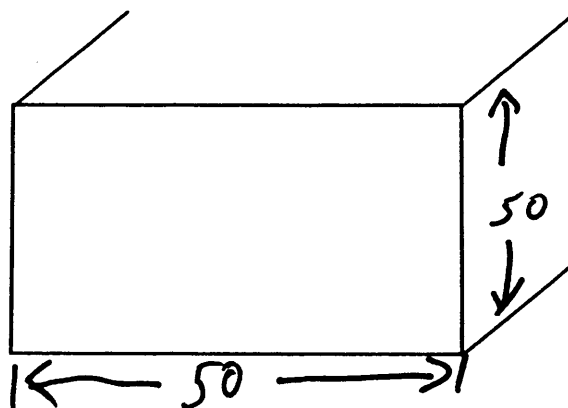

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

01
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
- (2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
- (9) UNKNOWN

1
15

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
- (2) SECOND
- (3) THIRD
- (4) FOURTH
- (7) OTHER: _____
- (8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
- (9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
- (2) LEFT CENTER
- (3) CENTER
- (4) RIGHT CENTER
- (5) RIGHT
- (6) ALL (LYING ON SEAT)
- (8) EXTERNAL TO PASSENGER
COMPARTMENT
- (9) UNKNOWN

1
17

POSTURE

- (10) SITTING ON SEAT
- (11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
- (12) SITTING ON CONSOLE
- (20) ON LAP OR IN ARMS
- (30) STANDING ON SEAT
- (40) STANDING ON FLOOR
- (47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
- (50) IN BASSINET
- (60) IN CHILD SEAT
- (65) IN CHILD HARNESS
- (70) LYING ON SEAT
- (80) LYING/SITTING ON PASSENGER
FLOOR
- (83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
- (85) ON CARGO FLOOR/FOLDED
SEAT-BACK
- (87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
- (97) OTHER: _____
- (99) UNKNOWN

10
18 19

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
- (98) 98 YEARS OR OLDER
- (99) UNKNOWN

36
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
- (25) 25 MONTHS OR OLDER
- (99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(135 lb)

061
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(54, 6 in)

168
27 28 29

SEX

- (1) MALE
- (2) FEMALE
- (9) UNKNOWN

2
30

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
- (01) FIRST AID AT SCENE
- (02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
- (03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
- (04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
- (05) FATAL, DEAD AT SCENE
- (06) FATAL, DOA
- (07) FATAL, DEAD WITHIN 24 HOURS
- (08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
- (09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
- (10) FATAL DEAD WITHIN UNKNOWN
PERIOD
- (99) UNKNOWN

04
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

24
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
- (1) YES, TIME & TYPE UNKNOWN
- (2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
- (3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
- (4) PREGNANT
- (5) POST-CRASH FATAL (DROWNING)
- (6) POST-CRASH NON-FATAL INJURY
- (7) OTHER: _____
- (8) COMBINATION OF ABOVE
(CIRCLE EACH)
- (9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

3
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: _____
- (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN


0
47

SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

7
48

INDICATE LOCATION OF INJURIES.

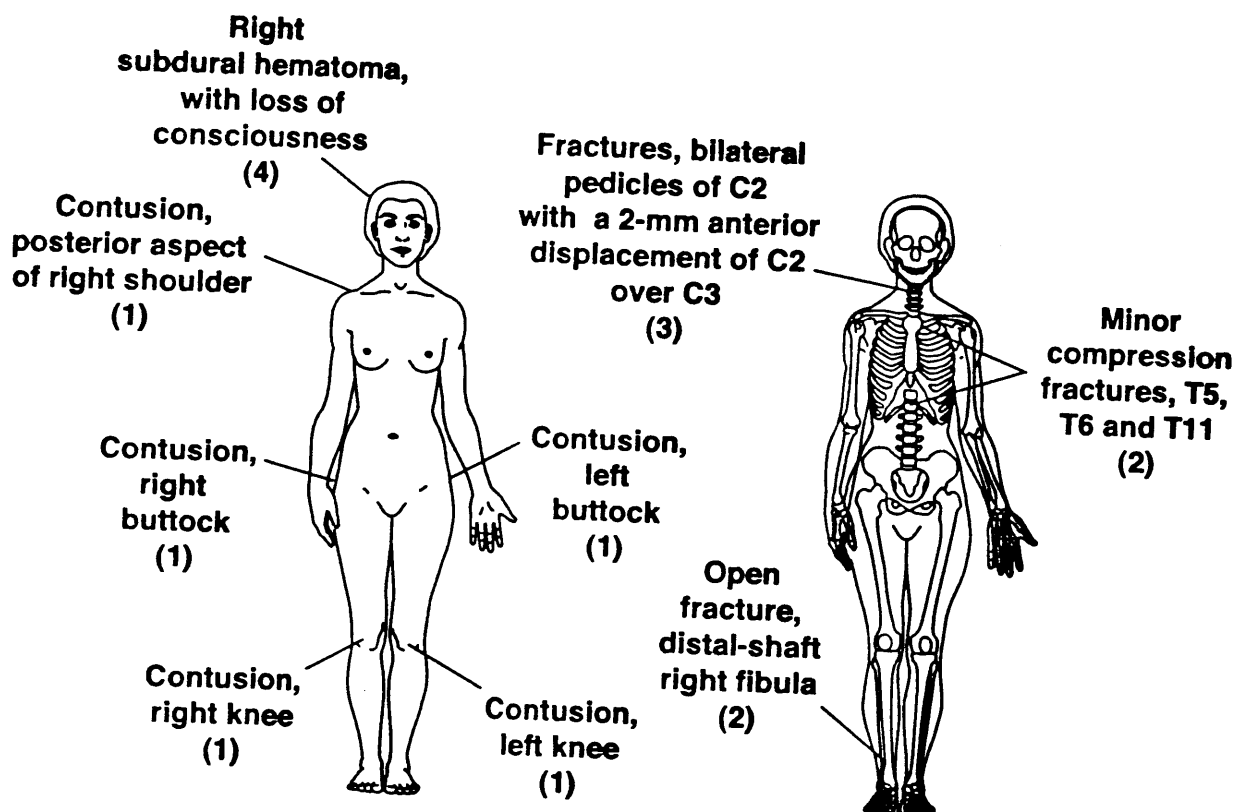

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS	
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5		
		17-18	19-20													
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30		
<u>01</u>	<u>01</u>	<u>68</u>	<u>--</u>	Transmission tunnel	<u>H</u>	<u>R</u>	<u>U</u>	<u>B</u>	<u>4</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>02</u>	<u>20</u>	<u>40</u>		<u>N</u>	<u>P</u>	<u>Z</u>	<u>V</u>	<u>3</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>03</u>	<u>29</u>	<u>40</u>		<u>S</u>	<u>R</u>	<u>C</u>	<u>I</u>	<u>1</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>04</u>	<u>20</u>	<u>40</u>		<u>B</u>	<u>S</u>	<u>F</u>	<u>S</u>	<u>2</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>05</u>	<u>27</u>	<u>40</u>		<u>P</u>	<u>R</u>	<u>C</u>	<u>I</u>	<u>1</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>06</u>	<u>27</u>	<u>40</u>		<u>P</u>	<u>L</u>	<u>C</u>	<u>I</u>	<u>1</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>07</u>	<u>99</u>	<u>--</u>		<u>K</u>	<u>R</u>	<u>C</u>	<u>I</u>	<u>1</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>08</u>	<u>99</u>	<u>--</u>		<u>K</u>	<u>L</u>	<u>C</u>	<u>I</u>	<u>1</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>09</u>	<u>38</u>	<u>--</u>		<u>L</u>	<u>R</u>	<u>F</u>	<u>S</u>	<u>2</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		
	<u>--</u>	<u>--</u>	<u>--</u>		<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>	<u>--</u>		

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (*X*)
- (55) MIDDLE INSTRUMENT PANEL (*Y*)
- (56) LOWER INSTRUMENT PANEL (*Z*)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER

- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE

- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN

- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK

- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)

- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)


PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

THE FIGURE BELOW
IS AN EXPLANATION OF THE BODY REGION CODES
LISTED ON PAGE IC - 4.

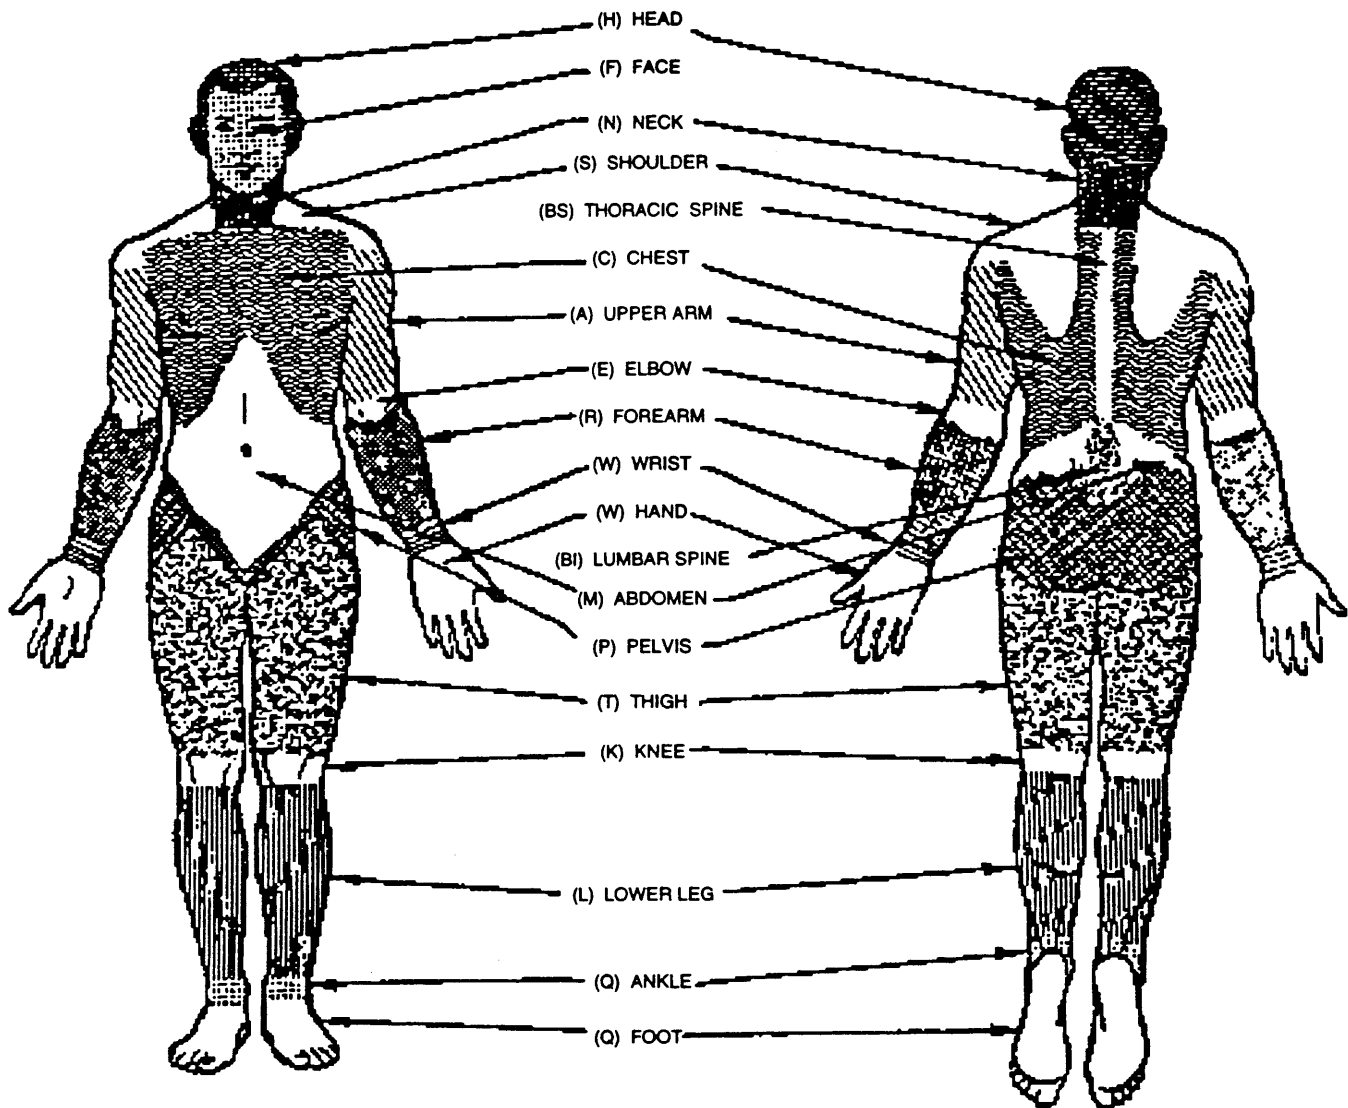

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

(H) HEAD/SKULL
(F) FACE
(N) NECK
(S) SHOULDER
(X) UPPER EXTREMITIES
(A) ARM (UPPER)
(E) ELBOW
(R) FOREARM
(W) WRIST/HAND
(C) CHEST
(M) ABDOMEN
(B) BACK
(P) PELVIC/HIP
(Y) LOWER EXTREMITIES
(T) THIGH
(K) KNEE
(L) LEG (LOWER)
(Q) ANKLE/FOOT
(O) WHOLE BODY
(U) UNKNOWN

3 LESION

(L) LACERATION
(C) CONTUSION
(A) ABRASION
(F) FRACTURE
(P) PERFORATION, PUNCTURE
(K) CONCUSSION
(V) AVULSION
(R) RUPTURE
(S) SPRAIN
(D) DISLOCATION
(N) CRUSH
(M) AMPUTATION
(B) BURN
(G) DETACHMENT, SEPARATION
(Z) FRACTURE AND DISLOCATION
(T) STRAIN
(E) TOTAL SEVERANCE, TRANSECTION
(O) OTHER
(U) UNKNOWN

4 SYSTEM/ORGAN

(S) SKELETAL
(V) VERTEBRAE
(J) JOINTS
(D) DIGESTIVE
(L) LIVER
(N) NERVOUS SYSTEM
(B) BRAIN
(C) SPINAL CORD
(E) EARS
(O) EYES
(A) ARTERIES
(H) HEART
(Q) SPLEEN
(G) UROGENITAL
(K) KIDNEYS
(R) RESPIRATORY
(P) PULMONARY/LUNGS
(M) MUSCLES
(T) THYROID, OTHER ENDOCRINE GLAND
(I) INTEGUMENTARY (SKIN)
(W) ALL SYSTEMS IN REGION
(U) UNKNOWN

2 ASPECT

(R) RIGHT
(L) LEFT
(B) BILATERAL
(C) CENTRAL
(A) ANTERIOR/FRONT
(P) POSTERIOR/BACK
(S) SUPERIOR/UPPER
(I) INFERIOR/LOWER
(W) WHOLE REGION
(U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

5 SEVERITY
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE
(1) MINOR
(2) MODERATE
(3) SERIOUS
(4) SEVERE
(5) CRITICAL
(6) MAXIMUM
(9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

02
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

2
15

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

5
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: In handicapped
(99) UNKNOWN position seat

97
18 19

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

10
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

(999) UNKNOWN

(55 lb)

025
24 25 26

HEIGHT (cm)

(999) UNKNOWN

(4 ft, 0 in)

122
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

1
30

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

02
31 32

INJURY SEVERITY SCORE (ISS)

(99) UNKNOWN

04
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: Multiple birth defects
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

7
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
 (1) C - POSSIBLE INJURY
 (2) B - NON-INCAPACITATING
 (3) A - INCAPACITATING INJURY
 (4) K - FATAL
 (5) INJURED, SEVERITY UNKNOWN
 (6) DIED PRIOR TO IMPACT
 (7) NON-FATAL INJURY,
 SEVERITY UNKNOWN
 (9) UNKNOWN

1
36

CHILD SEAT TYPE

- (00) NONE USED
 (01) YES, USED
 (02) INTEGRAL, Chrysler Mini-van
 (88) NOT APPLICABLE
 (ADULT OR OLDER CHILD)
 (99) UNKNOWN

0 1
41 42

CHILD SEAT MAKE/MODEL

"Tumble Foam"

Position seat

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
 (1) LAP BELT
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
 (1) LAP BELT ONLY
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NONE AVAILABLE)
 (9) UNKNOWN

7
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
 (1) AIR BAG INSTALLED
 (2) PASSIVE UPPER TORSO
 WITH KNEE BOLSTERS
 (3) PASSIVE UPPER TORSO
 WITHOUT KNEE BOLSTERS
 (4) PASSIVE LAP & UPPER TORSO
 (5) AIR BAG INSTALLED &
 PASSIVE RESTRAINT
 (7) OTHER: _____
 (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
 (1) AIR BAG NOT DEPLOYED
 (2) AIR BAG DEPLOYED
 (3) AIR BAG NOT REINSTALLED
 (4) PASSIVE UPPER TORSO USED
 (5) PASSIVE LAP & UPPER TORSO USED
 (6) SYSTEM USED IN MANUAL MODE
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NOT ORIGINALLY
 EQUIPPED)
 (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
 (1) PARTIAL
 (2) COMPLETE
 (7) EJECTED, DEGREE UNKNOWN
 (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
 (02) WINDOW, RIGHT SIDE
 (03) WINDOW, REAR
 (04) DOOR, LEFT SIDE
 (05) DOOR, RIGHT SIDE
 (06) DOOR, REAR OR TAILGATE
 (07) WINDSHIELD
 (08) ROOF OR OPEN CONVERTIBLE OR
 FROM EXTERNAL AREA
 (96) EJECTED AREA UNKNOWN
 (97) OTHER AREA: _____
 (98) NOT APPLICABLE (NOT EJECTED)
 (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE
 IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION



- (0) NOT EQUIPPED OR REMOVED
 (1) EQUIPPED
 (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

<p>OCCUPANT EYEWEAR</p> <p>(0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER _____ (8) NOT APPLICABLE (9) UNKNOWN</p>	<p><u>0</u> 47</p>	<p>SOURCE OF INFORMATION</p> <p><u>6</u> (0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER _____ (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN</p>	<p><u>7</u> 48</p>
--	------------------------	--	------------------------

INDICATE LOCATION OF INJURIES.

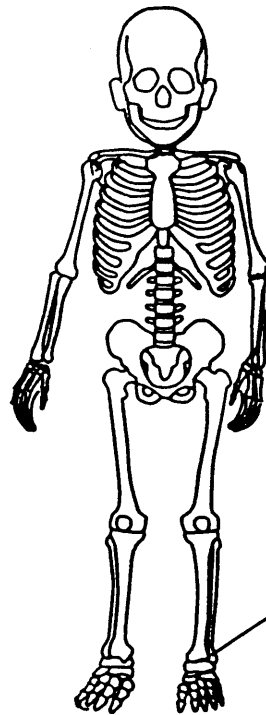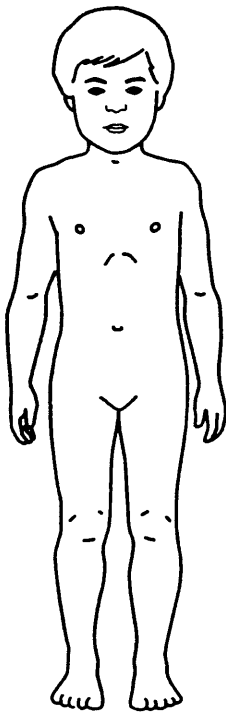

Hairline fracture,
distal
left fibula
(2)

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

[illegible]

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) & OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (*X*)
- (55) MIDDLE INSTRUMENT PANEL (*Y*)
- (56) LOWER INSTRUMENT PANEL (*Z*)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) & OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

Duplicate columns 1-8
from the previous card.Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION OCCUPANT NUMBER <u>03</u> 13 14 ROLE OF OCCUPANT AT 1ST IMPACT <u>2</u> 15 (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN		PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN <u>15</u> 20 21 AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN <u>25</u> 22 23 MASS (kg) (999) UNKNOWN <u>(130 lb.)</u> <u>059</u> 24 25 26 HEIGHT (cm) (999) UNKNOWN <u>(5ft, 8in)</u> <u>80</u> 27 28 29 SEX (1) MALE (2) FEMALE (9) UNKNOWN <u>1</u> 30	
OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: _____ (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN <u>2</u> 16 LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN <u>5</u> 17 POSTURE (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: _____ (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: _____ (99) UNKNOWN <u>10</u> 18 19		MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN <u>02</u> 31 32 INJURY SEVERITY SCORE (ISS) (99) UNKNOWN <u>01</u> 33 34 NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: _____ (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN <u>0</u> 35	

OCCUPANT INFORMATION OC-2


[illegible]

OCCUPANT INFORMATION OC-3


<p>OCCUPANT EYEWEAR</p> <p>(0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER _____ (8) NOT APPLICABLE (9) UNKNOWN</p>	<p><u>0</u> 47</p>	<p>SOURCE OF INFORMATION</p> <p>(0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER _____ (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN</p>	<p><u>7</u> 48</p>
--	------------------------	---	------------------------

INDICATE LOCATION OF INJURIES.

Small lacerations,
face and neck
(1)

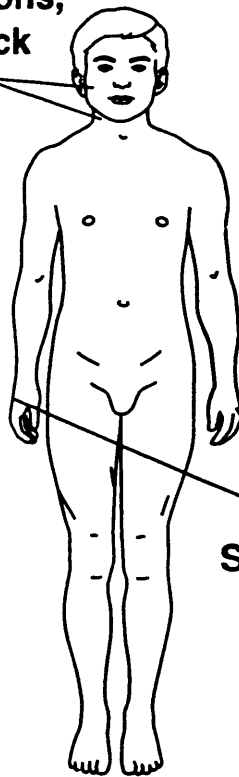

Small lacerations,
both hands
(1)

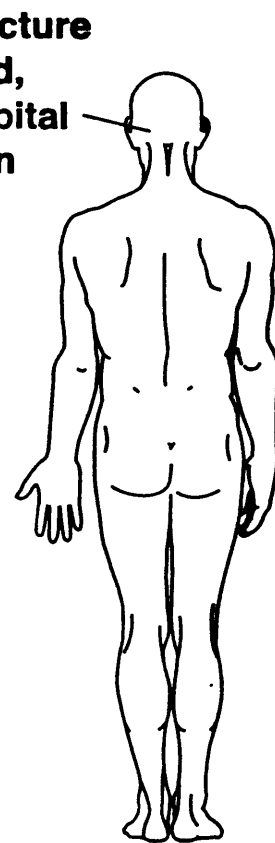

Small puncture
wound,
left occipital
region
(1)

INJURY CLASSIFICATION IC-1

OCCUPANT INJURY CLASSIFICATION

[illegible]

63

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (INSTRUMENT PANEL)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (AIRBAG)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK

- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)

- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (18) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS


- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (87) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

Case No.: 1699-00
Case Veh. #A: 1699 GAC
Type: Suburban BLT 4 x 4, 4-door SUV
Driver: 36 year-old female

Light/Conditions: Daylight
Weather: Snow
Road Surface: Snow
Road Construction: Asphalt



PN 16900 #1



PN 16900 #2



PN 16900 #3



PN 16900 #4




PN16900 #5



PN 16900 #6



PN 16900 #7

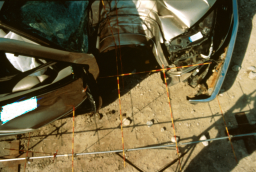

PN 16900 #8



PN 16900 #9



PN 18900 #10



PN 16900 #11



PN 16900 #12



PN 16900#13



PN 16900#14



PN 16900 #15



PN 16900 #16



PN 16900 #17



PN 16900 #18



PN 18900 #19



PN 16900 #20



PN 16900 #21



PN 16900 #22



PN 16900 #23



PN 16900 #24



PN 16900 #25



PN 16900 #28



PN 16900 #27



PN 16900 #28
Best Available



PN 16900 #29



PN 16900 #30
Best Available



PN 16900 #31



PN 16900 #32



PN 16900 #33



PN 16900 #34



PN 16900 #35



PN 16900 #36



PN 16900 #37



PN 16900 #38



PN 16900 #39



PN 16900 #40



PN 16900 #41



PN 16900 #42



PN 16900 #43



PN 16900 #44



PN 16900 #45



PN 16900 #46



PN 16900 #47



PN 16900 #48



PN 16900 #49



PN 16900450



PN 16800 #51



PN 16900 #52



PN 16900 #53



PN 16900 #54



PN 16900 #55



PN 16900#56



PN 16900 #57



PN 16900 #58



PN 16900 #59



PN 16900 #60



PN 16900 #61



PN 16900 #62



PN 16900463



PN 16900 #64



PN 16900 #65



PN 16900466

CASE NO: 166-66

CASE VEHICLE: 1989 GMC


TYPE: Suburban BLT 6 x 6, 4 door SUV

OCCUPANTS: Driver, 39-year-old female

STATURE: 168 CM (5' 6" H) 55 KG (121 LB)

RESTRAINTS: 3-point belt wgt w/L airbag deployed

SEVERITY: MAIS - 4 ISS - 24



CASE NO.: 169-00

CASE OFFICER: FMS EAC

TYPE: DISTURBANCE IN PUBLIC PLACES

OCCUPANT: Right front, 18-year-old male

STATUS: 168 cm (5' 6"), 61 kg (135 lbs)

RESTRAINTS: In "Typical-Restraint" position seat with
three-point harness, seat secured by
lap belt only - lap belt not fastened;
frontal-impact air bag deployed

SEVERITY: ISS - 2 ISS - 1

This occupant has severe left defects
including cognitive delay



Baseline fracture,
distal
left tibia
(2)

CASE NO. 100-00

CASE NUMBER: 1000-0000

TYPE: Suburban BLT 1 x 1, 4-door SUV

OCCUPANT: Right seat 10-year-old male

STATURE: 100 cm (3' 3", 8 1/2") MASS: 100 kg (220 lbs)

RESTRAINTS: 3-point seat belt

SEVERITY: MAIS = 1, ISS = 1

Small lacerations,
face and neck

(1)



Small lacerations,
upper limbs

(2)

Small puncture
wound,
left scapular
region

(1)

